


USER'S MANUAL

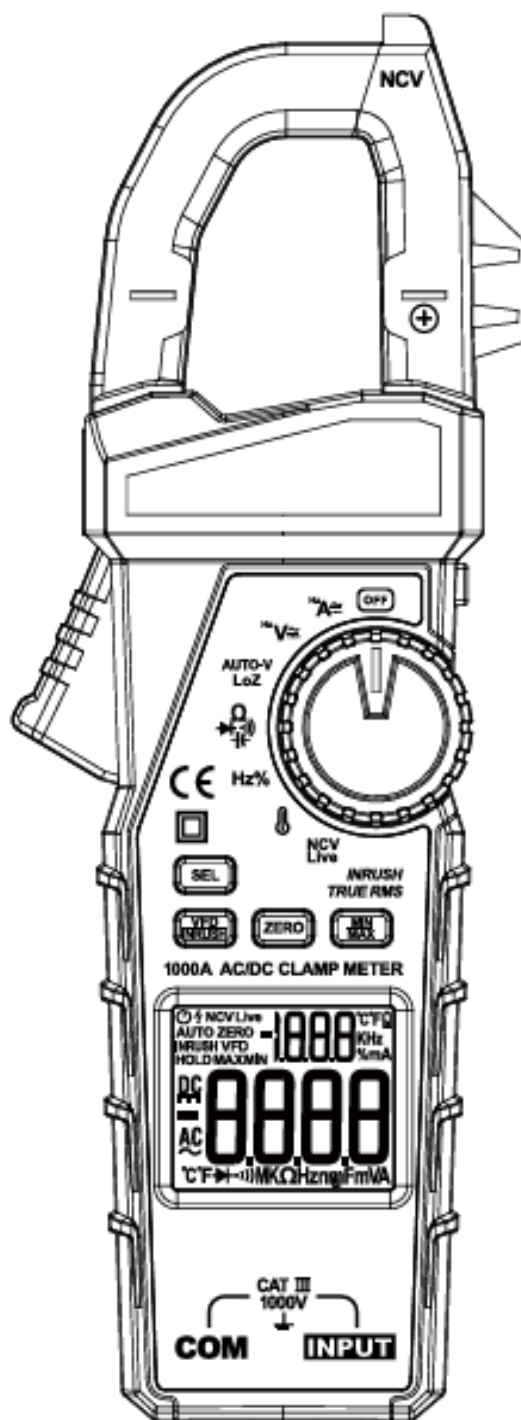

Digital Clamp Meter

⚠ Please read this manual carefully before using this product, and keep it properly for future use!

Introduction

-This is a powerful 6000-count AC/DC auto-ranging digital clamp meter. designed for voltage measurement and AUTO-V LOZ low impedance automatic voltage identification. inrush current measurement. frequency measurement. true RMS measurement. etc. It allows for quick and accurate measurement of various electrical parameters. making it an ideal tool for power maintenance. electrical installation. industrial testing and other fields.

-The meter can be used to measure AC/DC current. AC/DC voltage. resistance. capacitance. diode. continuity. frequency. percentage. temperature. It also includes functions like NCV. Live. MAX. MIN. HOLD. INRUSH. VFD. flashlight. automatic shutdown. full-range overload protection. low battery indication and so on.

1. Safety information



Attention should be paid to the use of the meter. Wrong operation may cause electric shock or damage to it. Please read the manual carefully before use and follow the instructions.

- * After receiving the meter. check for any damage during transportation.
- * Before use. ensure the meter's casing is intact. the insulation layer of the test probe is undamaged. the battery cover is closed and the screws are locked. and that the function range is correct.
- * Don't exceed the maximum measurement range or rotate the gear during measurement.
- * Do not touch the probe (metal part) when the meter is connected to a measuring circuit.

- * Operate carefully if measuring voltages above DC 60V or AC 30V (RMS). The maximum input voltage is AC 750V/DC 1000V.
- * Remove the test probe from the circuit before changing the measurement function.
- * When measuring the current, please remove the test probe from the COM and the INPUT terminals.
- * Before measuring resistance, continuity, diode, or capacitance, please disconnect the power supply of the circuit under test and discharge all high-voltage capacitors.
- * Do not use the clamp to measure AC/DC currents over 1000A.

2. Marks

Marks	Description
	AC voltage
	DC voltage
	Important safety information. Refer to the manual.
	Ground
	Double insulation
	High voltage warning
	Comply with European Union (EU) standards
CAT III	Overvoltage (installation) level III according to IEC-61010 standard

3.Symbols

3.1 Display

Symbols	Description
AUTO	Automatic measuring range
NCV	Non-contact voltage detection
Live	Live wire identification
HOLD	Data hold
MAX	Maximum value hold
MIN	Minimum value hold
ZERO	Zero adjustment
	Continuity test
	Diode
	AC voltage
	DC voltage
mV	Millivolt
V	Volt
VFD	Variable-frequency measurement
K	Kilo
HZ	Frequency
%	Percentage
A	Unit of current
INRUSH	Inrush current
nF	Unit of capacitance
uF	Unit of capacitance
mF	Unit of capacitance
Ω	Unit of resistance
K Ω	Unit of resistance
M Ω	Unit of resistance
°C	Unit of temperature
°F	Unit of temperature
	Low battery
	Auto- shutdown
-	Negative pole

3.2 Buttons

Buttons	Description
SEL	Function selection
MAX/MIN	Maximum/minimum value
ZERO	Zero adjustment
INRUSH/VFD	Inrush current testing/Variable-frequency measurement
HOLD/ 	Data hold/flashlight

3.3 Input terminal

Input socket	Description
COM terminal	Connect with the black probe.
INPUT terminal	Connect with the red probe.

4. Technical parameters

Automatic measuring range	Yes
Full range overload protection voltage	600V
Maximum input voltage at INPUT and COM terminal	DC 1000V/AC 750V
Display	LCD
Maximum display value	5999
Over-range display	0L or -0L
Sampling time	About 3 times/second
Auto-shutdown time	About 15 minutes
Backlight auto-off	About 3 minutes
Flashlight auto-off	About 5 minutes
Power Supply	2x1.5V AAA batteries
Operating temperature	0℃~50℃
Storage temperature	-10℃ ~ 60℃
Dimension	222x75x37mm
Jaw size	30mm
Weight	About 242g (Without battery)

5. Functions

- * SEL button: select NCV/Live. °C / °F . resistance/continuity/diode/capacitance. AC/DC voltage. AC/DC current.
- * MAX/MIN button: hold the measurement data in AC voltage/DC voltage/AC /DC mode. and press MAX→MIN→ to cancel the hold.
- * ZERO button: In DC mode. press and hold the ZERO button for more accurate measurements. and the screen display (**ZERO**) will eliminate the base number caused by the magnetic field interference in the use environment. thus obtaining more accurate measurement results.
- * VFD button: Start VFD (variable-frequency measurement) in AC voltage and current mode to effectively reduce high-frequency interference on measurement results. This ensures stable and accurate measurement of variable frequency voltage or current. even in the presence of high-frequency noise.
- * INRUSH button: To measure the peak current flowing into the load when the power is on. press and hold the INRUSH button in AC current mode to enter the inrush current measurement function. Before measuring. disconnect the load's power supply. Hold the meter trigger. open the jaw. and place the single wire (neutral wire or live wire) of the circuit to be measured at the center of the clamp head. When the jaw is completely closed and the power is on. the meter will capture the peak current of the load at the moment as it flows through the clamp. Change the range or press and hold the INRUSH button again to exit.


- * Auto-shutdown function: The meter automatically enters sleep mode after 15 minutes of inactivity. To wake it up, simply press any button.
- * Cancel the auto-shutdown function: Turn the rotary switch to the OFF position. While holding down the SEL button, turn the switch on and the meter will emit three long and one short beeps, indicating that the auto-shutdown function can be cancelled. Note that the auto-shutdown function will be restored after the next restart.
- * Battery undervoltage indication: Battery undervoltage indication: When " "appears on the screen, it indicates that the battery is low. To ensure accurate measurements, please replace the battery in time.
- * HOLD button: To hold the measurement data, press the HOLD button. In data hold mode, the buzzer will sound a warning every 2 seconds to remind you that the data is locked. To exit this mode, either turn the rotary switch or press the HOLD button again. Press and hold the button to turn the flashlight on or off.
- * Alarm prompt: When you use this instrument to measure AC/DC voltage reaching 600V, the red backlight of the instrument will automatically light up. When the test voltage reaches AC 750V/DC1000V, the buzzer will continue to emit a "beep" sound. This is to remind you that the current measured voltage has reached the maximum range of the instrument. Please operate with caution to avoid exceeding the range measurement and causing damage or measurement errors to the instrument.

6. How to Use

6.1 AC current

(1) Turn the switch to the ($\text{Hz} \text{ A} \approx$) position and the screen will display (**AC**).


(2) Hold the meter trigger and open the jaw. and place the single conductor of the tested line in the center of the clamp head. when the jaws are fully closed, the instrument screen displays the current value and frequency of the tested circuit.

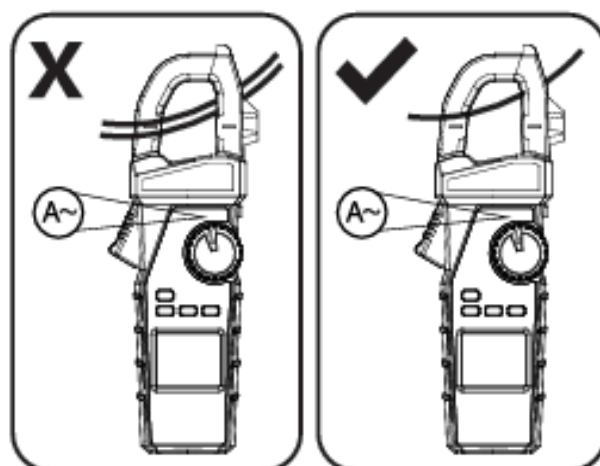

6.2 DC current

(1) Turn the switch to the ($\text{Hz} \text{ A} \approx$) position and press SEL button to switch the DC current measurement mode. the screen displays (**DC**).

(2) Hold the meter trigger and open the jaw. and place the single conductor of the circuit to be measured in the center of the clamp head. When the jaw is completely closed. the meter screen will display the current value of the circuit.

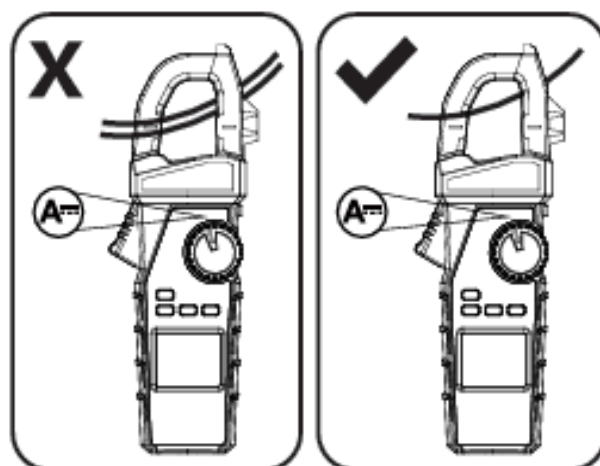


Attention!

- ① Only a single wire should be placed in the clamp for measurement and placing two or more wires simultaneously will result in incorrect readings. ensure the load is active during measurement.
- ② To ensure the measurement accuracy. press the ZERO button in DC current mode to clear the base number caused by electromagnetic interference in the use environment. After zeroing. keep the same direction for measurement.
- ③ If the measured current shows a negative value. please adjust the measuring direction of the clamp head to make the load current flow through the clamp head in a positive direction.

6.3 DC voltage

(1) Turn the switch to the ($\text{Hz V}_{\approx}$) position. the screen shows that (**DC**), and the meter is in DC voltage measurement mode.


(2) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the circuit for measurement. and the voltage value is displayed on the screen.

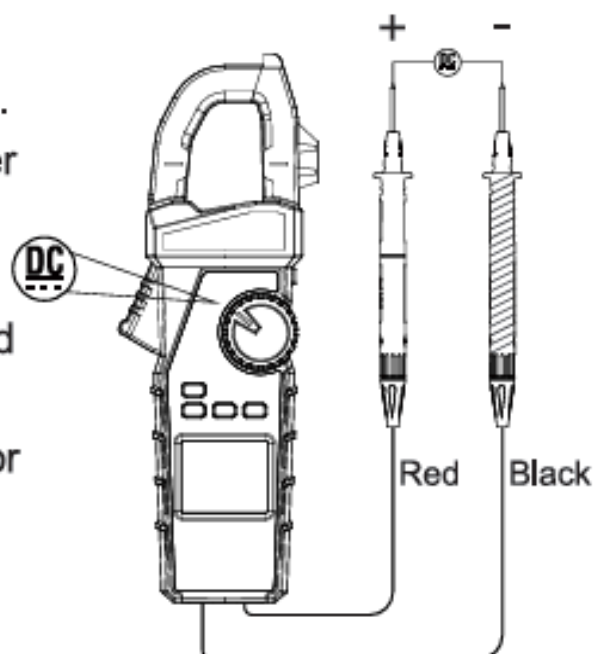

6.4 AC voltage

(1) Turn the switch to the ($\text{Hz V}_{\approx}$) position. press SEL button to switch to the AC voltage position. and the screen displays (**AC**). The meter is in the AC voltage measurement mode.


(2) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the circuit for measurement. and the voltage value and frequency are displayed on the screen.

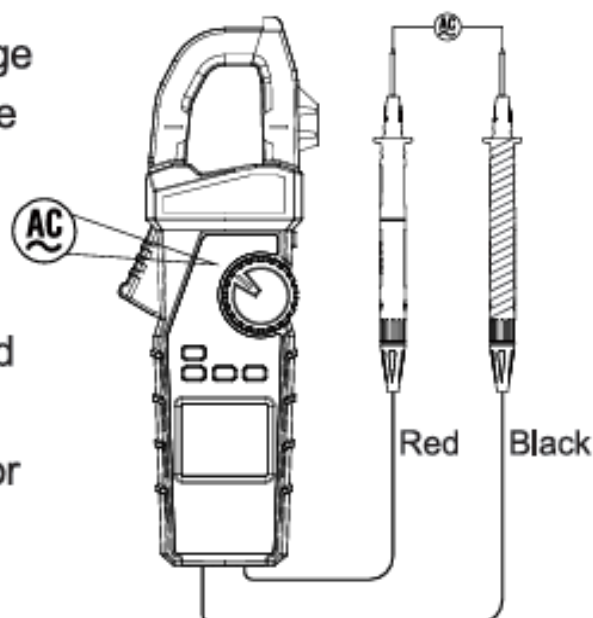

6.5 AUTO-V LOZ low impedance AC/DC voltage automatic identification function

(1) Turn the rotary switch to the (AUTO-V LOZ) position. and the meter is in the low impedance voltage automatic identification mode. In this mode. there is no need for any conversion. and the meter will automatically identify the voltage as AC or DC according to the measured voltage signal.

(2) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the circuit for measurement. the screen displays the voltage value of the tested circuit.

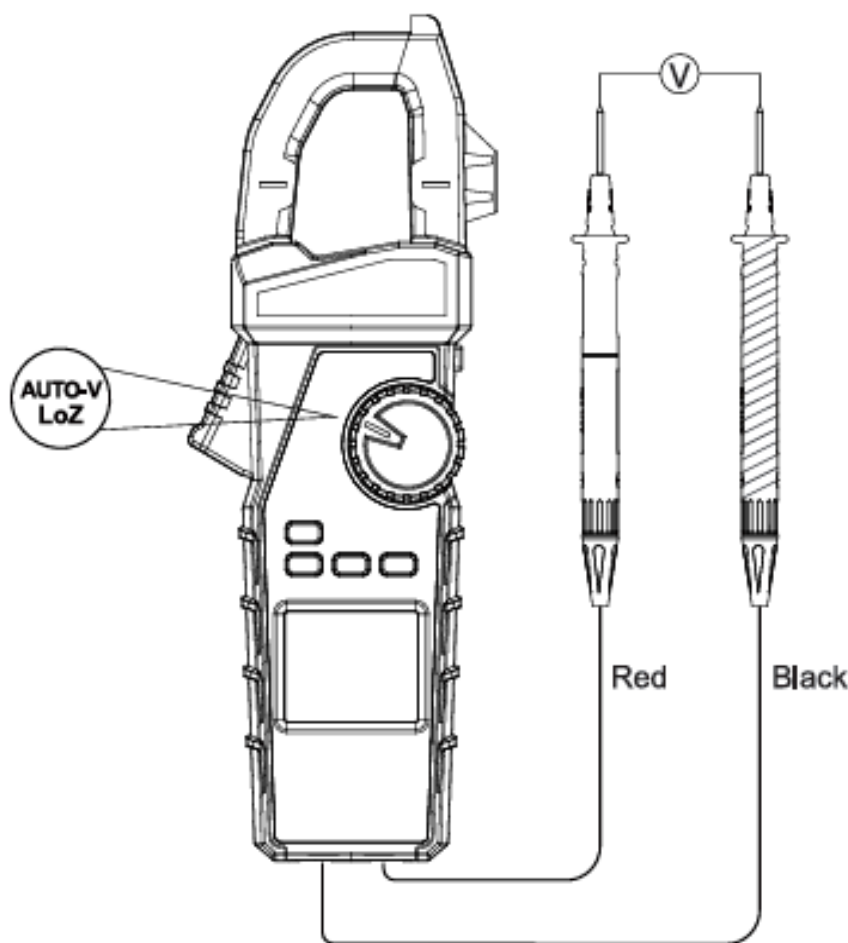

6.6 Resistance


(1) Turn the switch to the (Ω) position. the screen shows that (Ω). and the meter is in resistance measurement mode.

(2) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the circuit for measurement. and the screen shows the resistance value.

Attention!

① The measured resistance in the circuit will be different from the actual resistance value. because the measured resistance in the circuit will form series or parallel connection with other devices in the circuit. resulting in measurement error.

②. When the measured circuit is open or the resistance is too large. the screen displays (OL). indicating that the measured value is out of range.

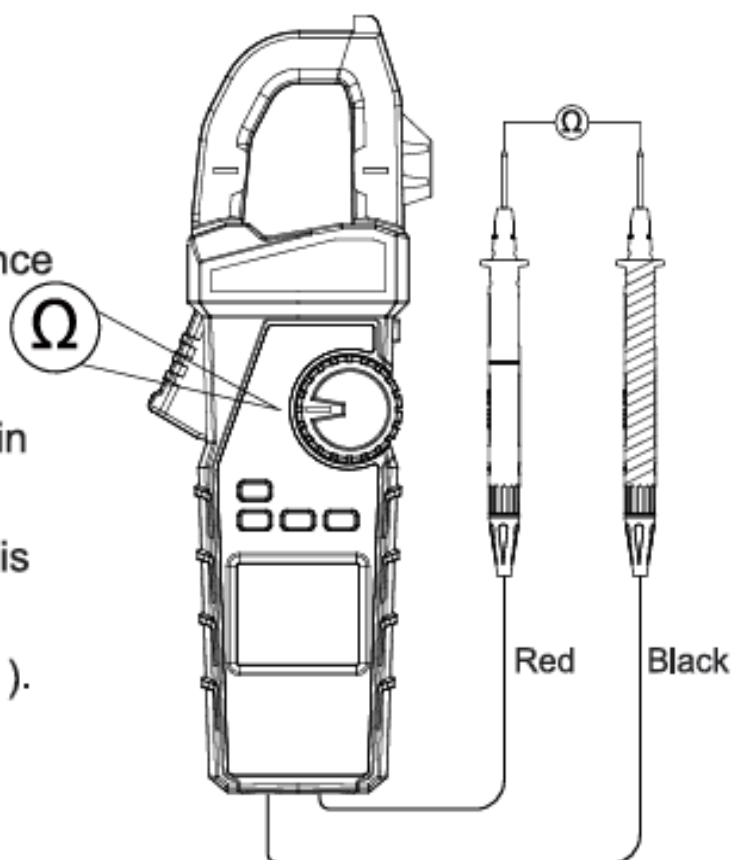


6.7 Continuity test

- (1) Turn the switch to the () position.
- (2) Press SEL button to select continuity measurement mode. and the screen will display ().
- (3) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the circuit for measurement.

Attention!

- 1.If the resistance value of the circuit is less than 50Ω . the meter buzzer will give a continuous alarm. indicating that the circuit is conductive. and the resistance value will be displayed on the screen.
- 2.If the resistance value of the circuit is over 50Ω . the meter will not give a buzzer alarm. but display the resistance value of the circuit on the screen. and when the resistance value is $> 610\Omega$. the screen will display ().

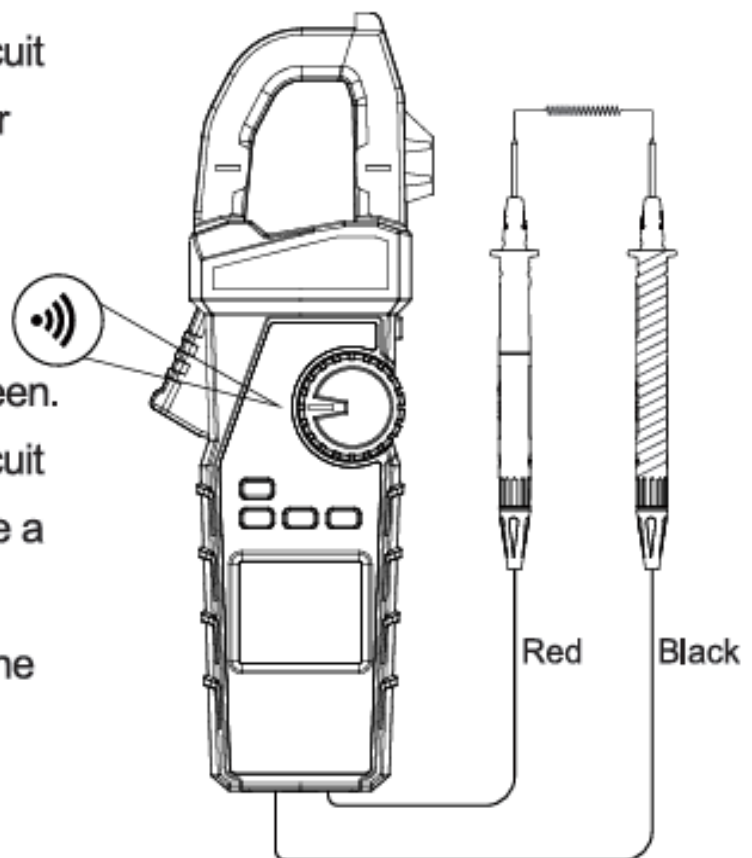


6.8 Diode

- (1) Turn the switch to the () position.
- (2) Press the SEL key to select the diode measurement mode. screen display ().
- (3) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the diode for measurement. and the on-voltage value of the diode is displayed on the screen.

Attention!

- ① When measuring a normal diode. the meter displays the forward voltage drop value. but it is not conductive in the reverse direction.
- ②. The load voltage of the diode is about 4V/ current is about 1.2mA.

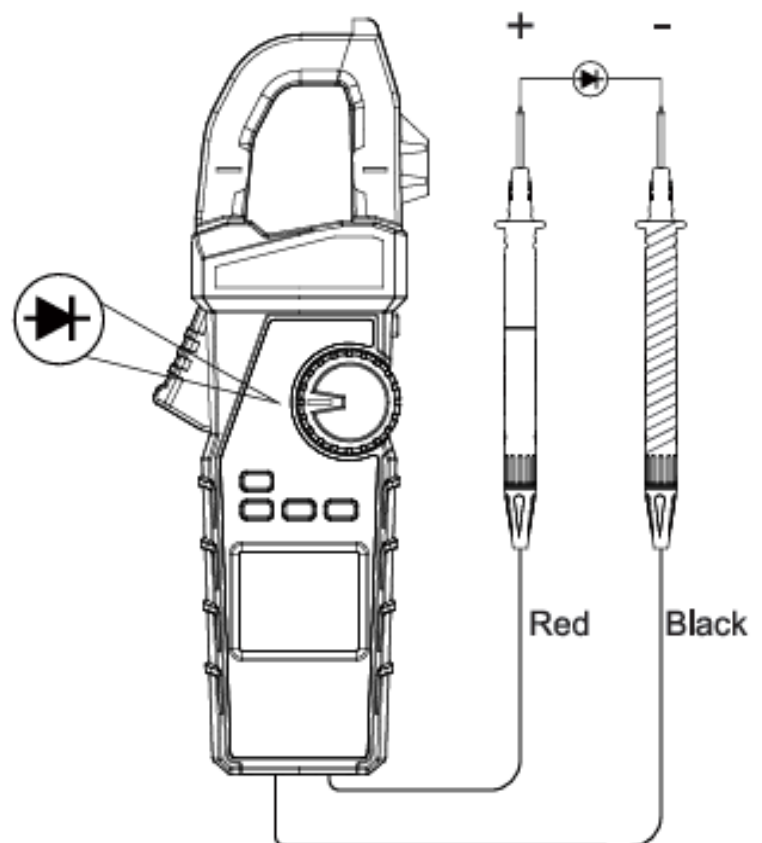


6.9 Capacitance

- (1) Turn the switch to the ($\rightarrow \Omega \rightarrow$) position.
- (2) Press SEL button to select capacitance measurement mode. and the screen will display (nF).
- (3) The black probe is connected to the "COM" terminal. the red probe is connected to the "INPUT" terminal. and the red and black probes are connected to the capacitance for measurement. the screen displays the measured capacitance value.


Attention!

- ① When measuring the capacitance. the capacitance should be discharged first. and the meter will charge the capacitance when measuring. so it takes some time to stabilize the measured data.
- ② Measuring the capacitance on the circuit will form parallel or series connection with other devices. which will interfere with the measurement results and make it impossible to directly measure the accurate value of the capacitance.

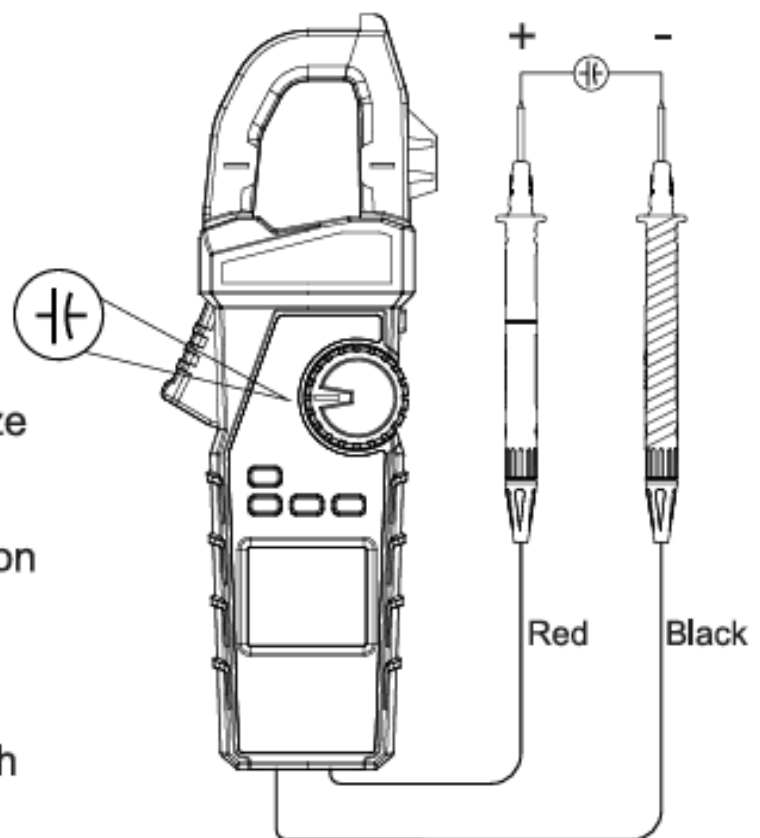

6.10 Frequency

- (1) Turn the switch to the (HZ%) position. and the screen will display (**Hz**).
- (2) The black probe is connected to the “COM” terminal. the red probe is connected to the “INPUT” terminal. and the red and black probes are connected to the measured signal source. and the frequency value is displayed on the screen.

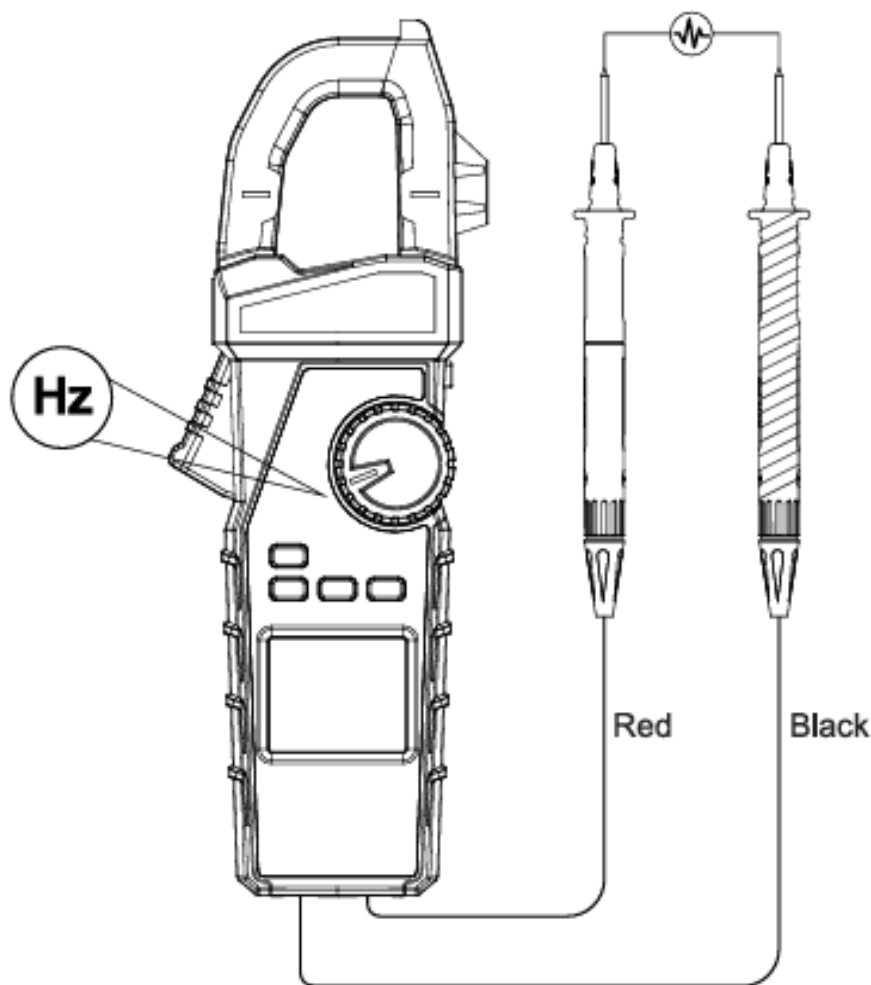


Attention!

- ① When measuring the frequency. the instrument screen synchronously displays the percentage of the measured signal.

6.11 Temperature

(1) Turn the switch to the () position. the meter will automatically measure the current ambient temperature. and the current temperature value will be displayed on the screen. Press the SEL button can switch $^{\circ}\text{C}/^{\circ}\text{F}$.

(2) To measure the temperature of an object or liquid. insert the red lead of the K-type thermocouple probe into the "INPUT" terminal and the black lead into the "COM" terminal. Then. place the thermocouple probe in contact with the object to be measured.

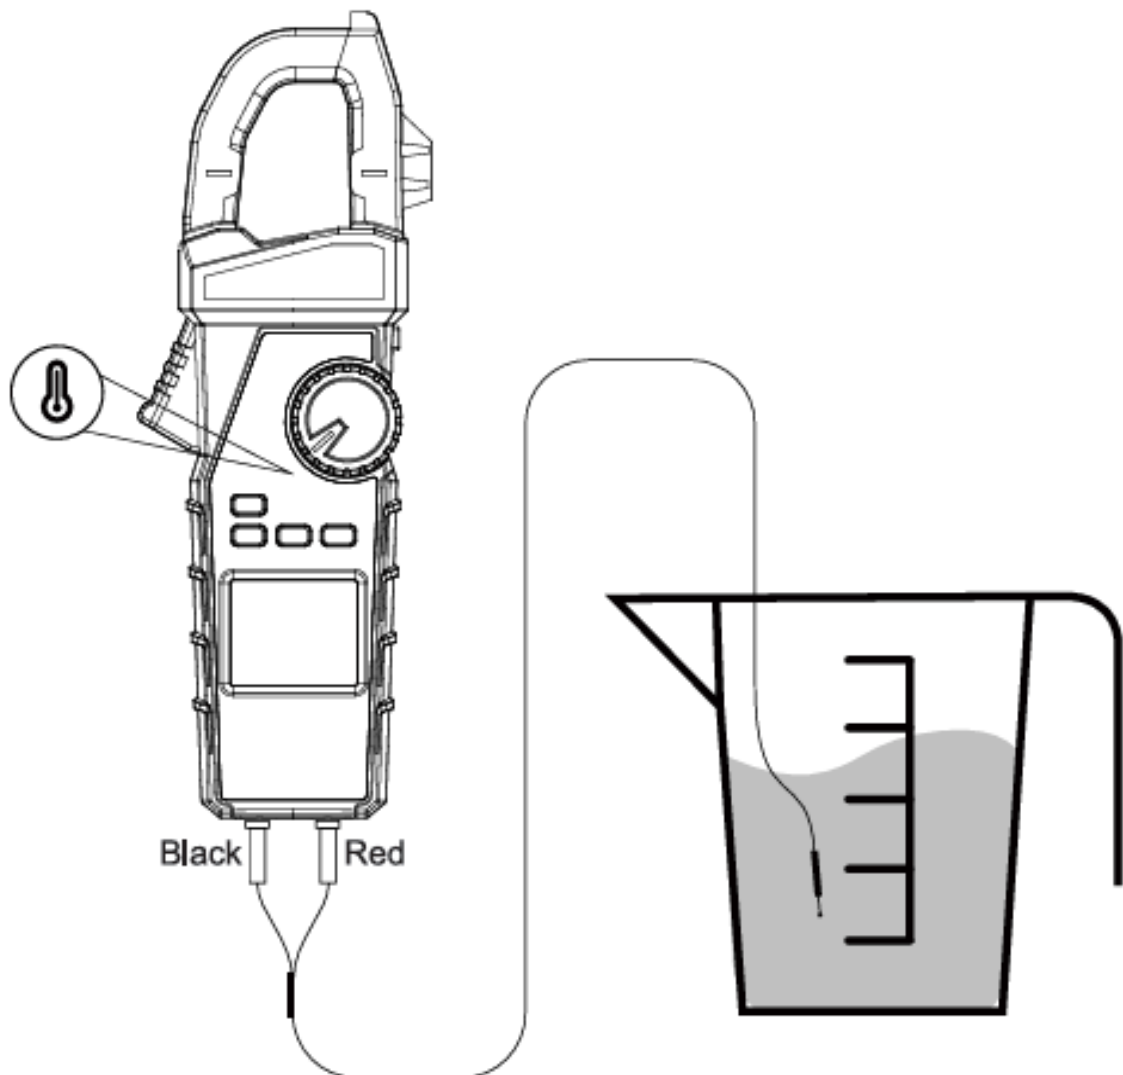


6.12 NCV non-contact AC voltage detection

- (1) Turn the switch to the (**NCV** Live) position. and the screen will display (**NCV**).
- (2) Close the end marked with "NCV" at the top of the clamp head to the conductor. and the meter will automatically detect the voltage signal. If the detected voltage is low. the screen displays (---L). If the detected voltage is high. the screen displays (---H). the red backlight lights up. and the buzzer also emits warning sounds with different frequencies to alert you that the conductor is live.

Attention!

- ① Even if there is no indication from the meter. the voltage may still exist. do not rely on non-contact voltage detection to determine whether there is voltage in the conductor to avoid danger.
- ② The detection process may be influenced by factors such as socket design. insulation thickness and types.
- ③ Interference from external environment (such as flashlights. motors. electromagnetic interference. etc.) may trigger non-contact voltage detection by mistake.

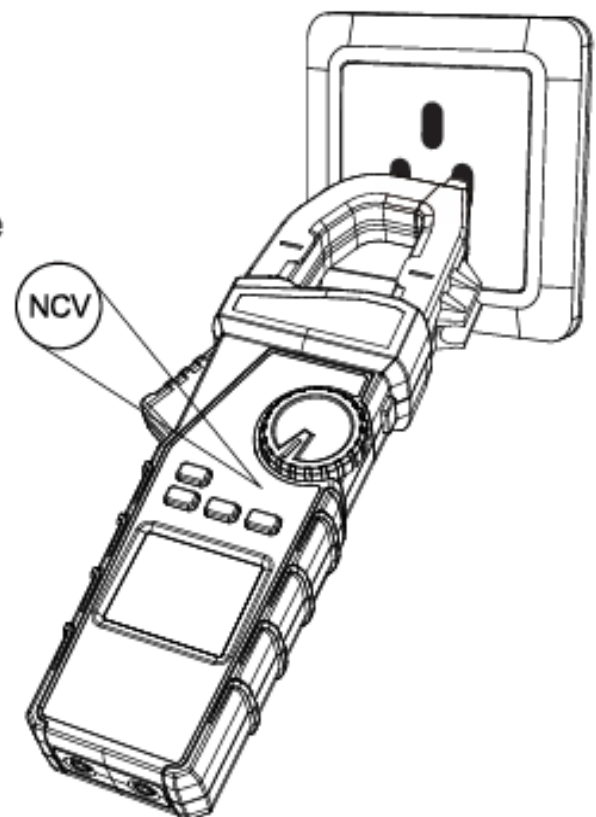


6.13 Live wire identification

- (1) Turn the switch to the (**NCV** **Live**) position. press the SEL button to switch the Live wire identification function. and the screen will display (**Live**).
- (2) Insert a single red probe into the INPUT terminal. and use the probe to contact the conductor to be tested for detection. If the screen displays (**LIVE**) and the red backlight is illuminated. while the buzzer sounds an alarm. the conductor being tested is a live wire. If not. it is a neutral or ground wire.

Attention!

- ① Before use. please test the meter on a known live conductor to ensure it's in good working condition.
- ② When testing the live wire of the socket. please unplug the other electrical devices before testing. if there are other electrical devices that may affect the measurement results.

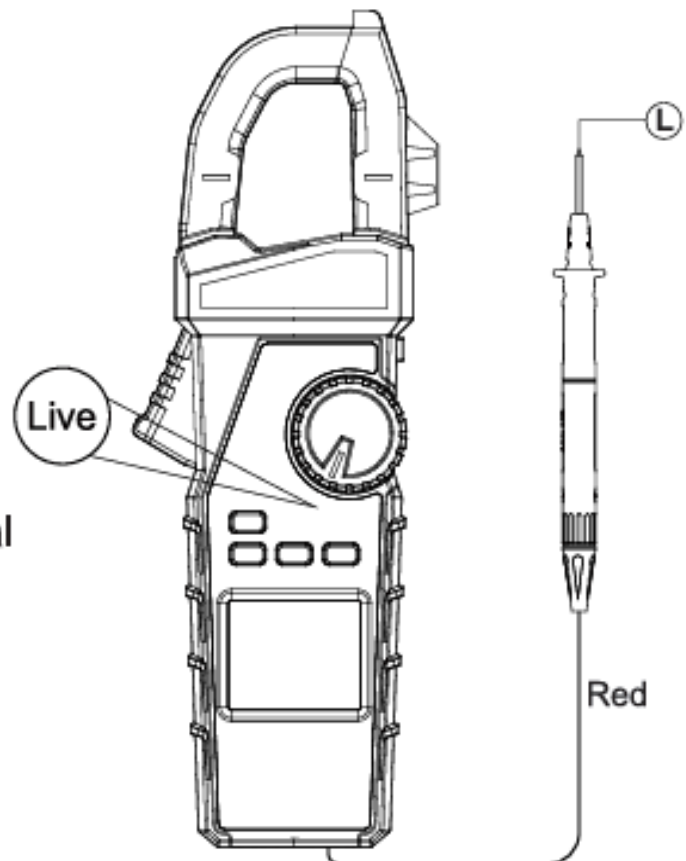

7. Technical indicators

7.1 AC current

Range	Resolution	Accuracy
6A	0.01A	$\pm(2.0\% \text{ reading} + 5 \text{ digits})$
60A	0.01A	
600A	0.1A	$\pm(3.0\% \text{ reading} + 8 \text{ digits})$
1000A	1A	

Maximum input current: AC 1000A

Frequency range: 50Hz~ 60Hz

7.2 Inrush current

Range	Resolution	Accuracy
1000A	1A	< 10A is for reference only. $\pm (10\% \text{ reading} + 60 \text{ digits})$

7.3 DC current

Range	Resolution	Accuracy
6A	0.01A	$\pm(2.0\% \text{ reading} + 5 \text{ digits})$
60A	0.01A	
600A	0.1A	$\pm(3.0\% \text{ reading} + 8 \text{ digits})$
1000A	1A	

Maximum input current: DC 1000A

7.4 DC voltage

Range	Resolution	Accuracy
600mV	0.1mV	± (1.0% reading + 5 digits)
6V	0.001V	
60V	0.01V	
600V	0.1V	± (1.2% reading + 8 digits)
1000V	1V	

Input impedance: 10MΩ

Maximum input voltage: DC 1000V.

7.5 AC voltage

Range	Resolution	Accuracy
6V	0.001V	± (1.2% reading + 5 digits)
60V	0.01V	
600V	0.1V	± (1.5% reading + 8 digits)
750V	1V	

Input impedance: 10MΩ

Maximum input voltage: AC 750V

Frequency response: 40Hz-1KHz

7.6 AUTO-V LoZ DC voltage

Range	Resolution	Accuracy
6V	0.001V	± (1.0% reading + 5 digits)
60V	0.01V	
600V	0.1V	± (1.2% reading + 8 digits)
1000V	1V	

Input impedance: 1M Ω / Maximum input voltage: DC 1000V

7.7 AUTO-V LoZ AC voltage

Range	Resolution	Accuracy
6V	0.001V	± (1.2% reading + 5 digits)
60V	0.01V	
600V	0.1V	± (1.5% reading + 8 digits)
750V	1V	

Input impedance: 1M Ω / Maximum input voltage: AC 750V

Frequency range: 40Hz-1KHz

7.8 Resistance

Range	Resolution	Accuracy
600 Ω	0.1 Ω	± (1.2% reading + 3 digits)
6k Ω	0.001k Ω	
60k Ω	0.01k Ω	
600k Ω	0.1k Ω	
6M Ω	0.001M Ω	± (2.0% reading + 5 digits)
60M Ω	0.01M Ω	

Overload protection: 600V / Open circuit voltage: about 1V

7.9 Continuity test

Function	Range	Description	Test condition
	600Ω	If the resistance is less than 50Ω. the buzzer will give an alarm.	Open circuit voltage: about 2V

Overload protection: 600V

7.10 Diode test

Function	Range	Test condition
	0-4V	Forward DC current: about 1mA open circuit voltage: about 4V.

Overload protection: 600V

7.11 Capacitance

Range	Resolution	Accuracy
6nF	0.001nF	±(4.0% reading + 5 digits)
60nF	0.01nF	
600nF	0.1nF	
6uF	0.001uF	
60uF	0.01uF	
600uF	0.1uF	
6mF	0.001mF	±(5.0% reading + 10 digits)
60mF	0.01mF	

Overload protection: 600V

7.12 Frequency

Range	Resolution	Accuracy
6HZ	0.001HZ	$\pm(1.0\% \text{ reading} + 3 \text{ digits})$
60HZ	0.01HZ	
600HZ	0.1HZ	
6KHZ	0.001KHZ	
60KHZ	0.01KHZ	
600KHZ	0.1KHZ	
10MHZ	0.001MHZ	

Overload protection: 600V

7.13 Temperature

Range	Resolution	Accuracy
-50~1000°C	1°C	$\pm(2.0\% \text{ reading} + 2 \text{ digits})$
-58~1832°F	2°F	$\pm(2.0\% \text{ reading} + 4 \text{ digits})$


Overload protection: 600V

8. Battery replacement



Before opening the battery cover to replace the battery, turn the meter off and ensure that the test probe has been disconnected from the measuring circuit.

- ① Turn off the meter.
- ② Remove the test probe from the measuring circuit.
- ③ Use a screwdriver to remove the screw of the battery cover on the back of the meter.
- ④ Remove the battery cover.
- ⑤ Remove the old battery.
- ⑥ Replace with the new 1.5Vx2 AAA batteries.
- ⑦ Install the battery cover and tighten the screws.

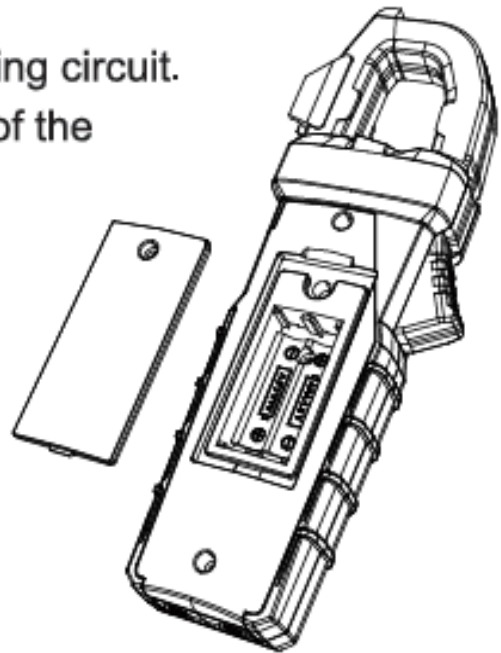

9. Accessories

1. Clamp meter	x1
2. User manual	x1
3. Test probe	x1
4. 1.5Vx2 AAA battery	x2
5. Thermocouple	x1
6. Storage bag	x1

USER'S MANUAL

Made in China

CE RoHS



M101040105

A1